

High-Precision Tuning Fork Electronic Balance

S J - C E Series

Operation Manual

IMPORTANT

- To ensure safe and proper use of the balance, please read this manual carefully.
- After reading this manual, store it in a safe place near the balance, so you can review it as needed.


SHINKO DENSHI CO., LTD.

PREFACE

Thank you for purchasing an SJ-CE Series electronic balance. This is a precision instrument equipped with exacting mechanisms in a compact body. The SJ-CE Series provides enhanced functions, including a counting mode for stock control of parts, a percentage mode for comparative measurements given in percentages, and a limit function for measuring constant quantities by consecutive weighings. Despite its many functions, the balance is easy to operate and features user-friendly keys. Furthermore, the large liquid-crystal display provides excellent visibility, and the instrument's high speed and stability–intrinsic to a tuning fork design–help boost operational efficiency.

Before using the balance, please check that the following items have been included in the package.

Should you find any missing parts, please contact your local dealer.

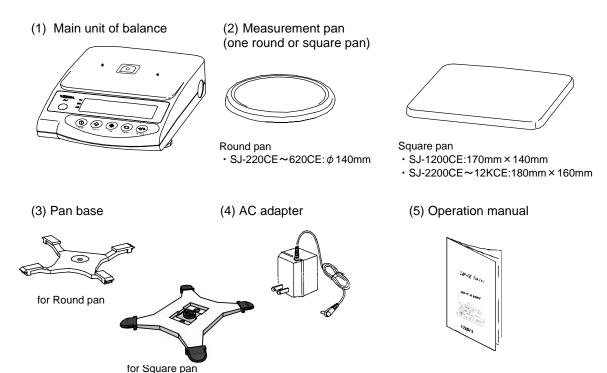

CONTENTS

1.	Precautions on the Use2				
2.	Nam	es of Component Parts5			
	2.1	Main Unit5			
	2.2	LCD Indicators and Operating Keys			
		6			
3.	Basi	c Operations8			
	3.1	Installation8			
	3.2	Operation Check9			
	3.3	Operation for Tare Subtraction10			
4.	Fund	etions12			
	4.1	Setup and Checking of Functions .12			
	4.2	Description of Functions13			
	4.3	Interface Section14			
5.		ching Function for Units of surement15			
6.	Cou	nting Pieces17			
	6.1	Sampling17			
	6.2	Increasing the Counting Accuracy (Memory Update Method)19			
7.	Meas	suring Percentage20			

8.	Limit	Function	22
	8.1	Limit Function Setup	22
	8.2	Setup of Limit Values by Actual Quantity Loads	24
	8.3	Setting up Limit Values by Inputting Values	_
9.	Calib	rating the Balance	27
10.	•	erating the Balance with the Batte	-
			29
11.		ubleshooting	
	Tro		30
	Tro	ubleshooting	30 31
	Spe 12.1	ubleshooting	30 31 31
	Spe 12.1 12.2	cifications	30 31 31 31

Precautions on the Use 1.

- This Section "Precautions Relating to Use" sets forth precautionary notes that the user should observe in order to prevent physical injury to the user and/or damage to property.
- The nature of problems that may result in the event of improper operation, and consequential effects on the quality and performance of the balance, are indicated under the two categories of "Caution" and "Recommended," and explained using symbols.



This symbol indicates a risk of injury or property damage if the balance is used improperly. Be sure to observe these notes to ensure safe use of the balance as the improper use may cause serious results.

RECOMMENDED

This term indicates steps that the user should take to ensure the quality and reliability of the balance.

Meanings of Symbols Each symbol is accompanied by an instruction.

Indicates a "mandatory" action that should be executed without fail.



Mandatory Symbol:



Indicates a "prohibited" action that must not be executed.











- * Do not disassemble or modify the unit.
 - Could cause malfunction or heat generation
 - · Contact our local dealer.





- X Only AC power (rated value) should be used.
- X Only use the dedicated AC adapter.
 - Use of other types of power or adapters may result in heat generation or malfunction of the balance.





- * Do not move the balance when a sample is loaded.
 - · The loaded sample may fall off the measurement pan and cause an injury.





Do not place the balance on an unstable base or use the balance in a location where it may be subjected to shock.





Do not lay the AC adapter cable on the surface of the passage.

 Somebody may trip on the cable, causing the balance to fall off, thereby causing injury and/or damage to the balance.





Do not touch the AC adapter or balance with wet hands.

· Danger of electric shock





Do not use the balance in a location were it may be subjected to excess moisture.

Electric shock or short-circuiting could occur. The balance may be corroded, with resultant malfunction.





Do not use the balance with its adjusters lifted.

The balance will become unstable, preventing accurate measurement.





Do not use the balance in a location where it may be subjected to excess dust.

Risk of explosion or fire Short-circuit or lack of continuity may occur, leading to a malfunction of the balance.

RECOMMENDED





Calibrate the balance after installation or relocation.

 Measurement values may contain errors, preventing accurate measurement from being conducted.





Avoid applying excess force or impact to the balance.





Do not use the balance in a location were it may be subjected to abrupt changes in ambient temperature or humidity.

Accurate measurement may not be obtained.

Optimum operations occur when ambient temperatures range from 10°C to 30°C, and less than 80% relative humidity.





Do not use the balance when [o-Err] (Overloaded) is displayed.

 Take down the loaded sample immediately to prevent breakage or malfunction.





Do not use the balance in a location where it is subject to direct sunlight.

The indications would be illegible.

An internal temperature increase in the balance may lead to inaccurate measurement.





If the balance is to be unused for an extended period of time, unplug the adapter.

This conserves power and prevents deterioration.






Do not use volatile solvents for cleaning.

The body may be distorted.

To clean the unit of stains, use a piece of dry cloth or cloth soaked in a small quantity of neutral detergent.





Do not use the balance in a location where it may be subject to air from an air-conditioning unit.

• Extreme changes in the ambient temperature may result in inaccurate measurements.





Do not use the balance on a soft floor.

 When loaded with a sample, the balance may tip or move, preventing accurate measurements from being conducted.






Do not use the balance when it is tilted.

An inclined balance is likely to produce errors, preventing accurate measurements from being conducted. Place the balance on a level surface.

2. Names of Component Parts

2.1 Main Unit

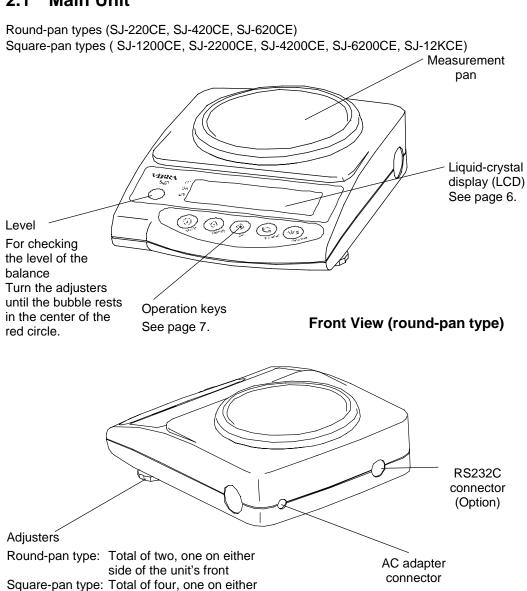


Rear view



side at front and rear

2.2 LCD Indicators and Operating Keys

2.2.1 Symbols Displayed

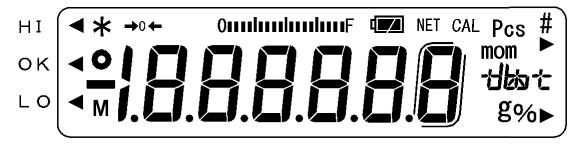

Display	Description			
g	Grams			
→0←	Zero point			
NET	Tare being subtracted			
0	Indication of stable balance (If the light is off, the balance is unstable.)			
*	Balance powered up (Lights up when the power is turned off) or data transmitted			
Pcs	Counting mode			
%	Percentage mode			
◀	Indication of judgement result (HI/OK/LO) when the limit function is active.			
mom	Momme			
M	Display of set values from memory (If a value is flashing, it is being saved.)			
CAL	Stays on and flashes while span adjustment is in progress.			
Ŋ	Auxiliary scale interval (Lights up only when the auxiliary scale interval is displayed.)%1			
Omponium E	Bar graph			
	[にた] (ct) carat ※3			
	[OZ] (oz) ounce			
db:	[ib] (lb) pound			
	[OZ t] (ozt) troy ounce			
* 2	[dvt] (dwt) penny weight			
	[t] (tl) tael (Hong Kong)			
	Upper right] (tl > Upper right) tael (Singapore, Malaysia)			
	Lower right] (tl Lower right) tael (Taiwan)			
	[†o] (to) tola			
Lights up when the balance is battery-operated. The indication chan [•] when the battery capacity decreases and charging is required "10. Operating the Balance on the Battery" on page 29.)				

[%] The mark is on t1he displayed only in SJ-620CE & SJ-6200CE when the balance is sealed.

^{%2} Except [ct], these units are available only when the balance is not sealed.


³ Not available in SJ-6200CE & SJ-12KCE

2.2.2 Names and Functions of Operating Keys


Operating Key		Function		
	On/off key	Key to turn on/off the unit power		
	Memory key	[Brief press] [Brief press]	initiates print or output. saves the settings of the number of pieces or percentages (%), or the limit value when using the limit function.	
	Set key	[Brief press] [Continuous press]	starts setting the number of pieces or percentages (%). starts setting the limit value when using the limit function.	
	Function key	[Brief press] [Brief press] [Brief press] [Continuous press] [Longer continuous press]	toggle-switches the units to be displayed in succession (g, Pcs, %, etc.). moves the flashing digit in the setup of a limit value when using the value input method. selects an item when setting the function. invokes various functions. invokes span adjustment.	
→0/T→	Zero/Tare key	[Brief press] [Brief press] [Brief press]	resets the indication to zero when using zero-point setup or tare subtraction. selects a value with the value input method when using the limit function. selects a function when operating the balance in the function mode.	

3. Basic Operations


3.1 Installation

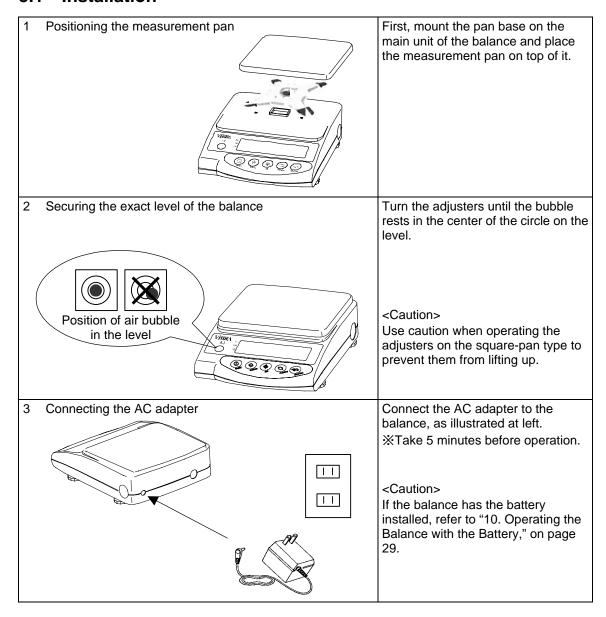


3.2 Operation Check

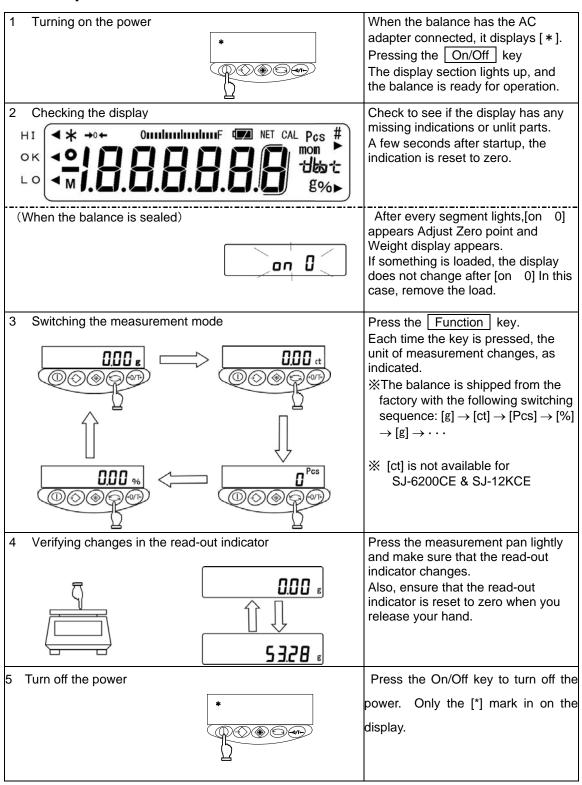

3.3 Operation for Tare Subtraction

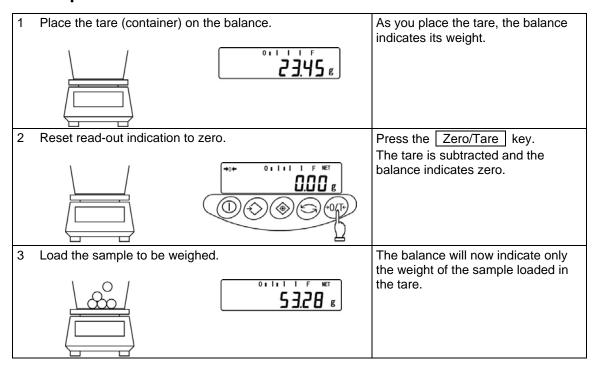


☆ Weighing only the weight of an added sample

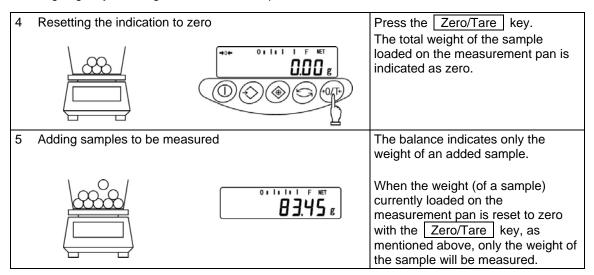

★ Key Points of the Procedure ★


The following applies equally to all the measurement modes for weight measurement, counting, and percentages.

- 1. After the balance is switched off, there is still enough current to display [*]. This indicates that the AC adapter is connected to an electrical outlet, but that the balance is turned off. When the balance is switched on again, [*] will disappear.
 - If the balance is running on batteries and the unit is switched off, the display does not display
 [*].
- 2. The bar graph shows the current load status with respect to the capacity of the balance. The nearer the [F] mark draws, the smaller the measurable weight becomes.
 - Even when the display currently indicates zero with the tare subtracted, the weight corresponding to the subtracted tare is indicated on the bar.



3. When the balance remains stable, the stability indicator [O] remains on. If the balance becomes unstable, the stability indicator [O] will disappear.

When a displayed value flickers or the stability mark flashes on and off, it is likely that the balance is being affected by wind or other vibrations. Use the windshield or vibration dampers to protect against such adverse effects.





4. When the read-out indicator is reset to zero or the tare is subtracted, the balance indicates zero this way: $[\rightarrow 0 \leftarrow]$. If the tare is subtracted, the indicator reads as follows: [NET].



*If the indication deviates from the true zero point by 1/4 of a graduation or less,[→0←] disappears.




*If the tare is subtracted, the balance indicates zero, and [NET] lights up.

- 5. When the tare is subtracted, the measurable range is reduced.

 Measurable Range = Capacity Tare Weight
- 6. If [o-Err] appears when a sample is loaded, the measurable range has been exceeded.
- 7. In counting mode or percentage mode, if no sample is stored in memory the indicator will not change, even when the measurement pan is pressed.
- 8. The measurement mode that is activated when the balance is switched on will be the one that was active when last switched off. For example, if the balance was switched off in counting mode, this counting mode will be reactivated the next time the balance is switched on.
- 9. To print data on the balance, set "Output Control (71.o.c.)" to [2], [4], [5], or [7], so that only stable data will be printed (see "4.3 Interface Section" on page 14).

4. Functions

4.1 Setup and Checking of Functions

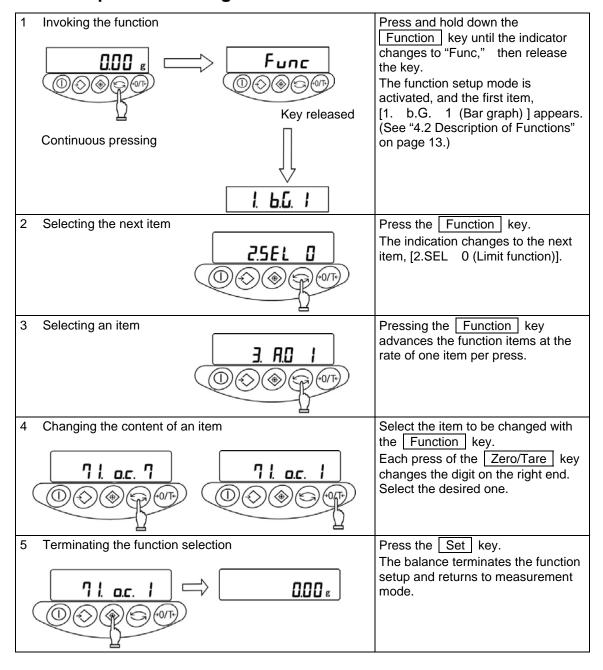

4.2 Description of Functions

Item		Set Va	alue	Description
Bar graph display		1. b.G.	0 ☆1	
Limit function		2. SEL	☆ 0	Disable Enable
n limit ted	Judgement condition	21.Co.	<u></u> \$1 2	Judge only when the balance is stable (does not judge if the balance is unstable)
Displayed only when limit function is activated	Judgement range	22.Li.	0 ☆ 1	Ranges beyond +5 graduation is judged (ranges +5 graduation or below, including negative ranges, are not judged.) The entire range is judged (the entire range, including the negative, is judged).
Displa fun	Number of points for judgement	23.Pi.	1 ☆2	One-point setup (judges between OK and LO) Upper-limit and lower-limit values are set up (judges among HI, OK and LO).
_	ito-zero o-tracking)	3. A.0	0 ☆1	Disable This function automatically sets the zero point exactly to zero to prevent slight deviations.
		4. A.P.	0 ☆ 1	Disable (balance operates continuously) Enable (balance powers off in approximately three minutes) This function is available only when the balance is battery-operated.
Response speed		5. rE.	0 1 2 ☆3 4	V 2
Stability parameters		6. S.d.	1 ☆2 3	Wide (mild) ↓ Narrow (strict)
Interface		7. I.F. ※1	0 ☆1 2	Six-digit numeric format
Register selected measuring units with Function key.		81.S.u. 85.S.u. <u>*</u> 2	1E	[

Items marked ☆ are the default factory settings. ☆1-☆5: default settings [81.S.u.]-[85.S.u.]

Setup of units of 81.S.u. ☆3 20		☆ 3 20	[Pcs]
measurement to be		☆4 1F	[%]
displayed	85.S.u.	☆ 5 00	Unit not set
		0	Disable
Display of the auxiliary scale interval	9. Ai ※4	☆1	Enable (is the auxiliary scale interval.) Note: The auxiliary-scale-interval place does not represent a verification scale interval. Use it only as a reference value.
Output format	he auxiliary A.PrF. nterval is ※5	1	No output is made while the auxiliary scale interval is displayed.
while the auxiliary scale interval is		2	Output is made even while the auxiliary scale interval is displayed.
displayed		☆ 3	Output is made with "/" added to the left of the auxiliary-scale-interval place.

X1 Setting is effective only when optional RS232C is used.

4.3 Interface Section

Displayed when [7. I.F. []] is set to [1] or [2]

Item	Set V	alue	Description			
	71.o.c.	0 1 2	Stop output Output continuous at all times Output continuous if stable (stop output if unstable) Outputs once by pressing Memory key (irrespective			
		4	been removed and the balance indicated zero, or less.			
Output Control		5	Outputs once if stable, and stops output when unstable. Even if the sample is not replaced, the balance is output once when it stabilizes next time (including the zero indication).			
					6	Outputs once if stable, and outputs continuously when unstable. Even if the sample is not replaced, output of the balance stops when it stabilizes after being output once.
		☆ 7	Pressing Memory key causes the balance to output once when stable.			
Baud Rate	72.b.L.	2	1200 bps 2400 bps 4800 bps 9600 bps			
Parity	73. PA.	1	None Odd Odd (7-digit numeric format)] is specified.			

[☆] denotes a factory-setting

^{※2} Can be set only for a model on which the balance is not sealed. For a model on which the balance is sealed, only the units set when the balance was unsealed are effective. ☆1-☆5: default factory settings [81.S.u.]-[85.S.u.]

³ Not available in SJ-6200CE and SJ-12KCE.

¾4 Applicable only in SJ-620CE & SJ-6200CE

^{%5} Displayed only in SJ-620CE & SJ-6200CE, when unsealed.


^{*}The data interval in continuous output mode is 0.1 to 1 second. (The interval varies depending on weighting conditions and other factors.)

5. Switching Function for Units of Measurement

Pressing the Function key allows the user to switch the unit of measurement to [g], [ct], [%], and so on.

Up to five different units can be registered for use only when the function key is properly set on a balance for which the balance is not sealed.


5.1 Switching Units of Measurement

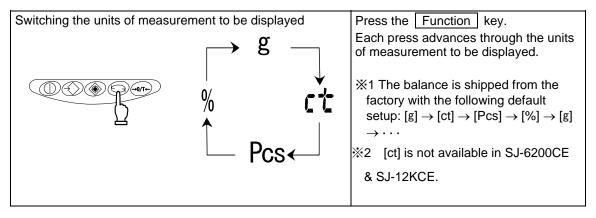


5.2 Setup of Units of Measurement (Only when the balance is not sealed)

When values [81.S.u.] to [85.S.u.] are entered prior to use, the desired unit of measurement to be displayed can be chosen simply by pressing the Function key. For more information on the units of measurement that can be set here, please refer to "4.2 Description of Functions" on page 13.

Example: To change the default factory settings to pound units, use [82.S.u.] in the factory settings.

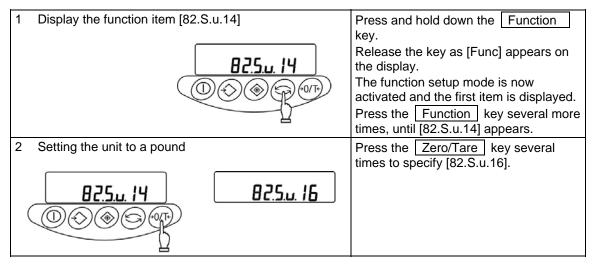

Example:To change the default factory settings to pound units use [82.S.u.] in the factory settings. (cont.)

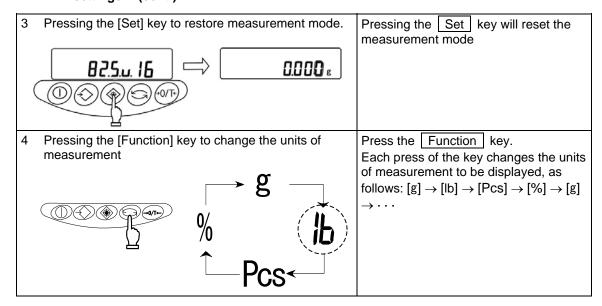


★ Key Points of the Procedure ★

- 1. When set values are entered in the function items [81.S.u.] to [85.S.u.] prior to use, the desired unit of measurement to be displayed can be selected simply pressing the Function key. For more information on the units of measurement that can be set, please refer to "4.2 Description of Functions," on page 13.
- 2. The units are displayed in the same sequence as the settings made from [81.S.u.] to [85.S.u.].
- 3. If [00] is set, no unit of measurement will be displayed, even when units of measurement are set in subsequent items.
- 4. [00] cannot be set in [81.S.u.].
- 5. If the same unit of measurement is set multiple times, the second time (and all subsequent times) the unit(s) occurs, it will be ignored when the display switches.
- 6. The units can be set only on the balance is not sealed.
- 7. When units other than [g] or [ct] is selected and the power is turned off, [g] is automatically selected the next time the power is turned on. (under the balance is sealed.)

6. Counting Pieces


To implement piece-counting, the specified samples are loaded on the balance, and their average unit weight (hereinafter, simply the "unit weight") is entered and saved. The procedure for saving unit weights is called sampling.


The counting procedure consists of loading articles that have already been sampled on to the balance. The number of pieces is then calculated by dividing the total weight of the loaded articles by the unit weight saved in memory. Piece counting cannot be implemented unless sampling has already taken place.

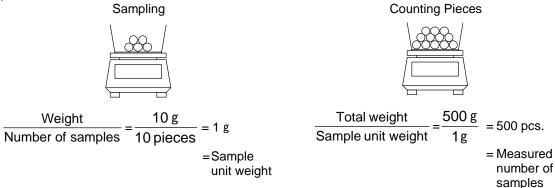

If samples to be counted deviate widely in weight, or a higher measure of accuracy is desired, it is recommended that users use the "Raising the Counting Accuracy" method. This procedure results in greater precision by increasing the number of samples used in the sampling operation.

6.1 Sampling

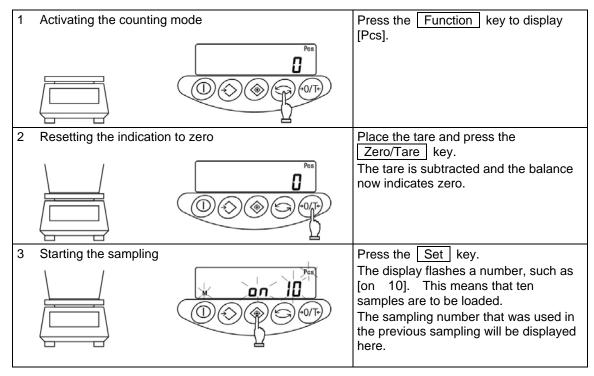

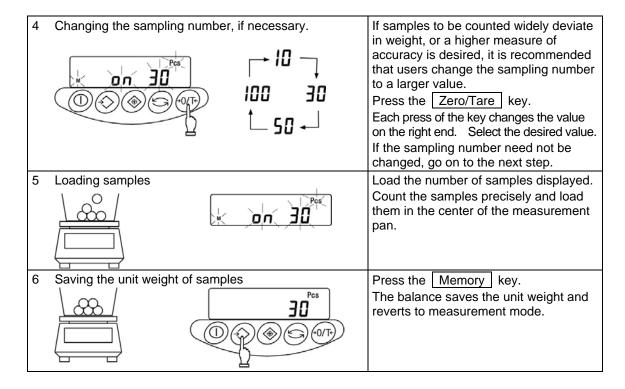

★ Key Points of the Procedure ★

- 1. While the samples are being saved, the value indication disappears and only [M] flashes to indicate that memory saving is underway. If the balance is affected by wind or other vibrations during this process, the saving time may be prolonged.
- 2. If [L-Err] appears, it indicates one of the following states:
 - (1) The weight of one sample (measurable unit weight) is insufficient. For the range of unit weights that can be measured and saved, please refer to "11. Specifications," on page 30.
 - (2) In the sampling of Operation Step 3, press the Set key with the samples loaded on the balance.
 - *If [L-Err] appears, the sampling is interrupted and the data in progress is not saved.
- The operation for increasing counting accuracy is referred to as the Memory Update Method.
 This procedure updates the memory with a unit weight that represents a more precise average by gradually increasing the sampling number.

This operation improves counting accuracy and is recommended for the following cases;

- (1) When the samples to be counted deviate widely in weight or the number of samples displayed deviates.
- (2) When greater accuracy is desired.
- 4. If [Add] appears in Memory Update Method, it indicates that a counting error is likely due to the small number of the samples loaded on the balance. [◄] will light up at the judgment indication "LO." As the memory update continues, counting accuracy improves and the above indication disappears.
- 5. If you change the sampling number, subsequent sampling will start from the new sampling number.


6.2 Increasing the Counting Accuracy (Memory Update Method)

*This procedure is the same as the sampling procedure described on the previous page up, to the point at which the sampling number is changed.

		1
1	Loading samples	Load the number of samples displayed. Count the samples precisely and load them on to the center of the measurement pan.
2	Saving the samples 10 pieces saved 10 pieces saved	Press the Set key. The unit weight of the samples is saved, and the display changes to a flashing value. This flashing value denotes that the Memory Update Method is currently active.
3	Adding samples	Add approximately an equal number of samples as the number currently displayed. Add them gradually, in groups of approximately the same number, until the number of samples is approximately double. The additional samples need not be counted.
4	Saving the samples 20 pieces saved 10 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0	Press the Set key. After the unit weight of the samples has been saved, the display begins to flash, indicating that the Memory Update Method is still running.
5	Repeating the addition and saving of samples	Repeat steps 3 and 4. The eventual total number of samples to be saved should be approximately 1/5 to 1/2 of the number of samples to be measured.
6	Terminating the sampling 125 pieces saved 125 pieces saved	Press the Memory key. The balance saves the unit weight and returns you to measurement mode.

7. Measuring Percentage

The percentage measurement function operates by weighing an actual sample, selected as the reference, and saving its weight as the reference value and indexing it as 100%. When a measurement sample loaded on the balance is lighter or heavier than the reference, its weight is indicated as a percentage (%) value relative to the reference weight.

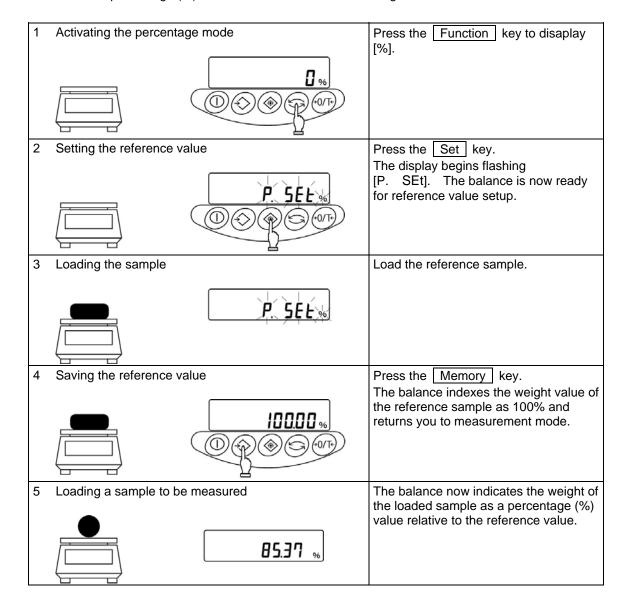

☆Key Points of the Prcedure ☆

- 1. While samples are being saved, the value indication disappears temporarily, and only the [M] mark flashes. If the balance is affected by wind or other vibrations during this process, the saving time may be prolonged.
- 2. If [L-Err] appears briefly, it indicates one of the following states:
 - (1) The weight of the reference sample is insufficient. For the limit weight that can be saved (% limit weight), please refer to "11. Specifications," on page 30.
 - (2) While setting up the reference value in Step 2, the Set key has been pressed while the samples were loaded on the balance.
 - ※If [L-Err] appears, sampling has been interrupted and the sample value being processed
 will not be saved.
- 3. The minimum intervals between percentages in the unit switch from 1%, to 0.1%, to 0.01%, depending on the reference weight from the sampling.

8. Limit Function

The limit function judges measurements according to a limit value saved in the balance.

The function shows the judgement result by displaying the [◄] mark as either HI (excessive), OK (appropriate), or LO (insufficient). This function is very useful when discriminating between conforming and nonconforming articles. It is also useful when measuring a given constant quantity consecutively, in conjunction with a range of reference weights defined by upper- and lower-limit values.

This function can be used in weight mode, counting mode, or percentage mode.

Limit value input methods

Either of the following two methods can be used in the different modes:


- (1) Actual quantity setup method An actual sample is loaded on the balance and its weight saved as the limit value.
- (2) Numeric value setup method The limit value is entered with a key stroke.
- *The limit values entered are held in memory, even when the balance is powered down.
- *The respective limit values for weight mode, counting mode, and percentage mode are set up independently.


Indication of judgement result

The |◀] mark lights up as either HI, OK, or LO on the left side of the display, indicating the result of judgement.


Judgement Results	Upper/lower-limit setting	One-point setting
HI (excessive)	Upper-limit value < measurement value	No indication
OK (appropriate)	Upper-limit value ≥ measurement value ≥ lower-limit value	Limit value ≤ measurement value
LO (insufficient)	Lower-limit value > Measurement value	Limit value > Measurement value

8.1 Limit Function Setup

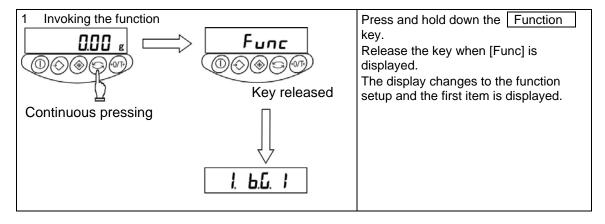


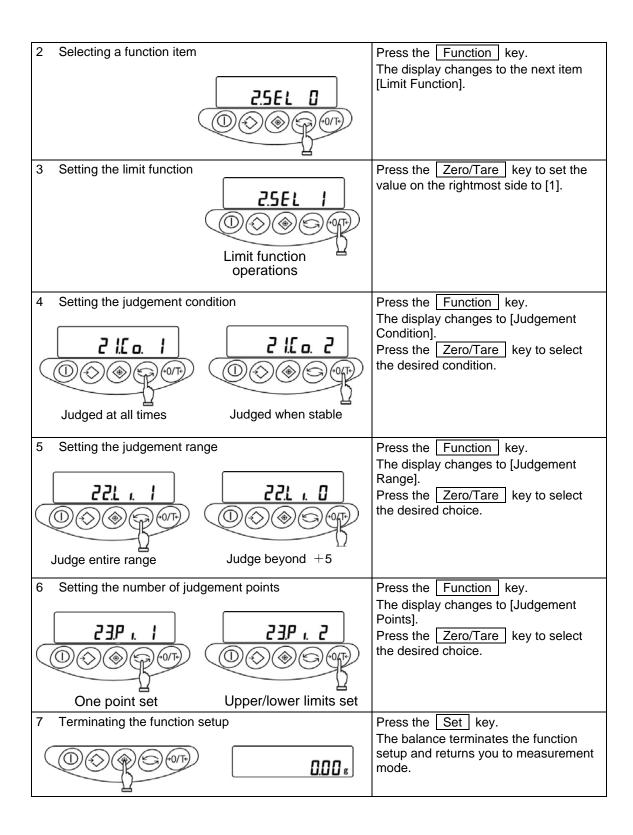


8.2 Setup of Limit Values by Actual Quantity Loads

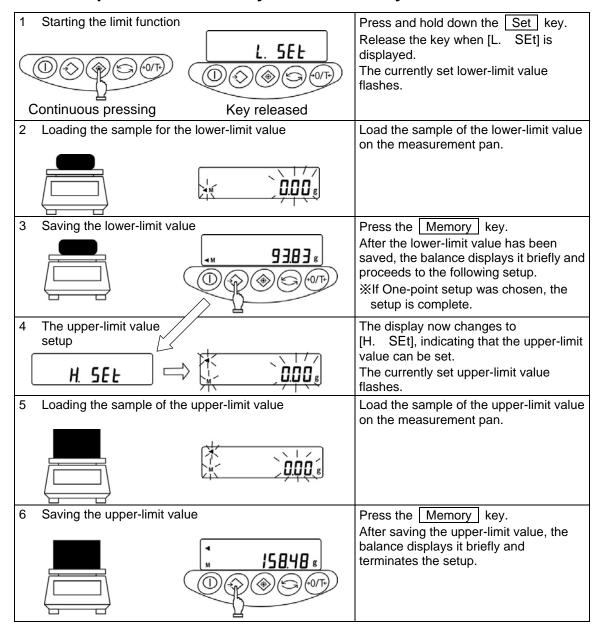

8.3 Setting up Limit Values by Inputting Values

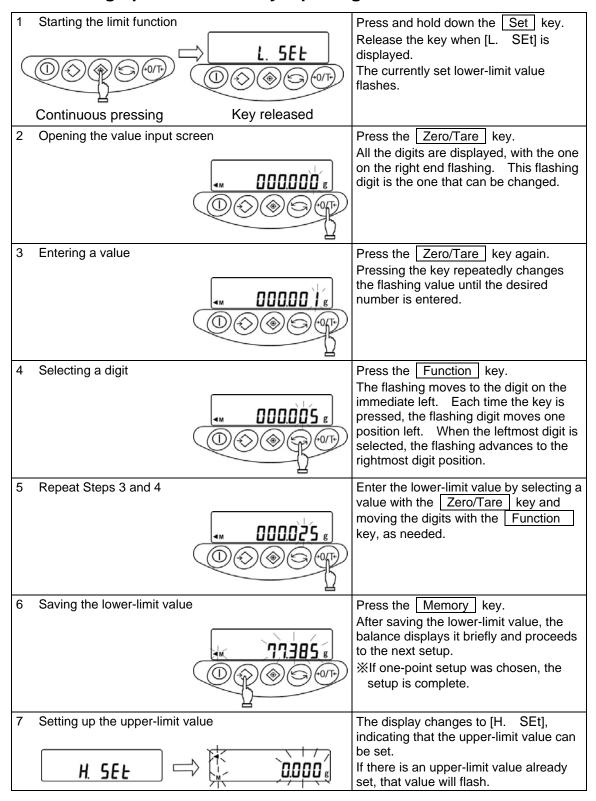


Setting up Limit Values by Inputting Values (cont.)

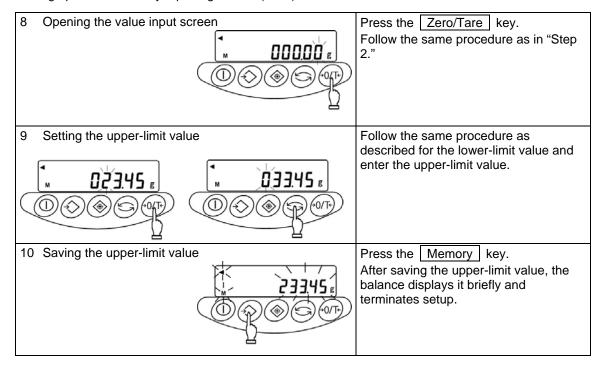

★ Key Points of the Procedure **★**

The limit values you have set can be checked each time you press the <u>Set</u> key.
 The balance displays the lower-limit value after showing [L. SEt], and the upper-limit value after showing [H. SEt].

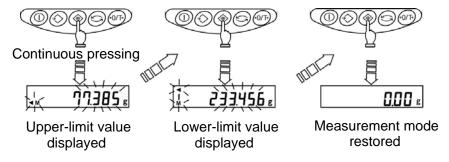

- 2. If you make a mistake, press the Function key during the setup of actual quantities or the Set key during the setup of values.
- 3. If you press the Memory key while a value is flashing, an actual quantity will be set based on the weight currently loaded on the balance. Pressing the Zero/Tare key at this time displays the value input screen.
- 4. If the [◀] mark lights up for all three judgement indicators, HI, OK, and LO, the lower-limit value set exceeds the upper-limit value. Check the values, since mistakes can occur with entries, as in cases when the upper-limit value is specified with a negative sign.
- 5. When the [M] mark is flashing on the value input screen, the sign on the left end can be changed. Press the Zero/Tare key to switch between the positive and negative signs.


9. Calibrating the Balance

Calibration is possible only when the balance is unsealed.


Since electronic balances are affected by gravity gravitational acceleration, they produce different values in various locations. Therefore, before use, balances must be calibrated at the location where they are installed. Calibration is also required after long periods without use, or if a balance beginsproduce inaccurate values.

Calibration of a balance, or "span adjustment," is required to produce accurate measurements.

· Span adjustment should be performed with the balance installed perfectly level and without any load on the measurement pan.

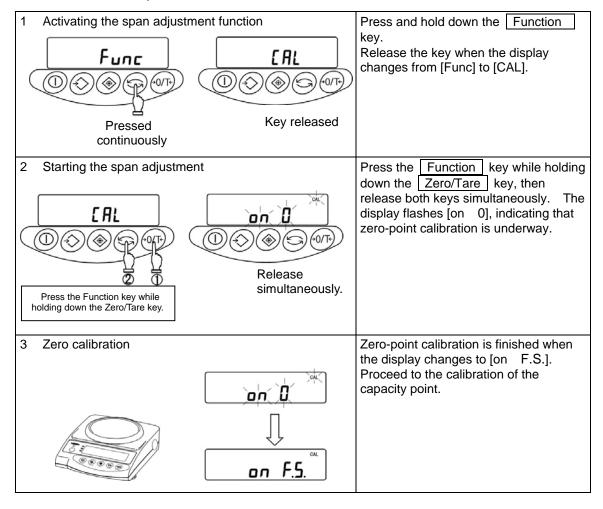

Calibrating the Balance (cont.)

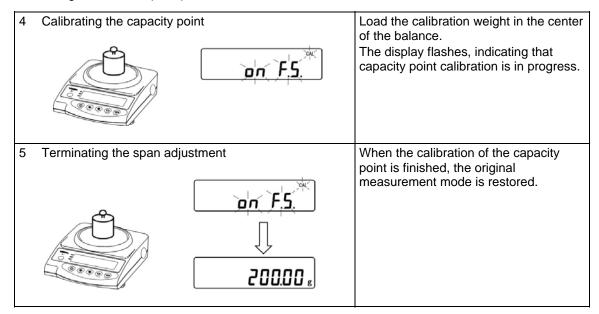

★ Key Points of the Procedure ★

- 1. Pressing the Function key in Step 2 interrupts the span adjustment and returns you to the original measurement mode.
- 2. The calibration weight used for span adjustment should be heavier than 50% of the capacity of the balance.

To implement a calibration as precisely as possible, use a weight close to the capacity of the balance.

- 3. If problems arise during span adjustments, one or more of the following error messages will appear:
 - (1) [o-Err]: The calibration weight exceeds the capacity of the balance.
 - (2) [1-Err]: The calibration weight is less than 50% the capacity of the balance.
 - (3) [2-Err]: The difference between before and after calibration values is too large (1.0% or more).

Check the weight and re-calibrate. If the same error continues after repeated calibrations using the correct weight, please contact our local dealer.

XIf error messages are displayed, calibration cannot take place.

10. Operating the Balance with the Battery

This function can be used only when the balance is battery-operated.

10.1 Specifications

· Built-in nickel-cadmium battery

· Charging time: Approximately 12 hours

• Drive time: Approximately 32 continuous hours

• Number of charge/discharge cycles: 300 or more

10.2 Charging Method

- · While the balance is battery-operated, [] stays on. The indicator flashes [] (charging required) when battery capacity decreases. If the balance flashes [], charge the battery by following these steps:
- (1) Connect the dedicated AC adapter to the balance.
- (2) Turn the balance off.
- (3) Charging takes approximately 12 hours, with power switched off.

10.3 User Precautions

- 1. Once charging is complete, use the balance without the AC adapter to avoid over-charging. This can occur since the balance continues to charge the battery with a weak current when the power is switched on. Overcharging will also decrease battery life.
- 2. When the balance is used for the first time after purchase, the operating time may be shorter than when using a fully charged battery. This is due to natural discharge of the battery. Although the balance can be used while [t__d] is flashing, it should be recharged as soon as possible.
- When the battery displays no indication, or an indication disappears quickly after the balance is switched on, battery capacity is low. In these cases, either charge the battery immediately or plug in the AC adapter.
- 4. Charging the battery while [is displayed reduces battery life.
- Cautions To operate the balance safely, observe the following (failure to do so could result in malfunctions, breakage, burst batteries, or fire):
- 1. Do not disassemble or modify the battery. Do not reverse the balance connection or short-circuit the positive and negative polarities of the balance.
- 2. Use only the supplied AC adaptor.
- 3. Do not incinerate used batteries. Dispose as hazardous material only.

11. Troubleshooting

X The numbers in () indicate reference pages

	* The numbers if	i () indicate reference pages
Symptom	Cause	Possible remediation
There is no indication on the display.	The AC adapter is not connected.	→ Check that the AC adapter is connected (8).
The display is unstable. [M] remains flashing without changing.	 The balance is subject to air currents or vibration. The balance is situated on an unstable surface. An object is contacting the sample being measured, the measuring pan, or the tare. 	→ Check Precautions on Use (2–4).
Weight indication contains an error.	 An error was made in the tare subtraction procedure. The adjusters remain lifted, resulting in an incorrect level. The indication values are inconsistent after long hours of use, or because the balance has been moved to a new location. 	 → Review the tare subtraction (10). → Check the level (8). → Execute span adjustment on the balance (27).
The limit function does not work.	 The limit function is not selected. The limit value has been erroneously entered. 	→ Check the operation of the limit function (22 on).
[Add] appears ([◀] and a value flash at [LO].)	 Likely to produce errors in the counting mode because the sample weight is insufficient. 	Execute the Memory Update Method (19).
[o-Err] appears before the capacity is reached.	 Gross weight exceeded the capacity of the balance (weight range = container + weight of sample). A section of the mechanism is damaged. 	 → Check the total weight. → Execute tare subtraction again. → Contact our local dealer.
[u-Err] is displayed.	 A foreign object is caught between the measuring pan (pan base) and the balance. A section of the mechanism is damaged. 	→ Remove the measurement pan and examine the surface beneath it.
[b-Err] is displayed. [d-Err] is displayed.	 The balance is exposed to static electricity or noise. The electrical system of the balance is malfunctioning. 	→ Contact our local dealer.
During span adjustment [o-Err] is displayed. [1-Err] is displayed. [2-Err] is displayed.	 A weight heavier than the capacity was used. The reference weight is less than 50% of the capacity. Calibration produced an error of 1.0% or more. 	Check that the span adjustment procedure was performed correctly (27).
During battery installation: The indication disappears. [I] flashes. No indication is produced.	 The automatic power-off function was activated. The battery capacity is low. 	 → Switch on the power again. Deactivate the Automatic power-off function, if necessary (13). → Recharge the battery (29). → Operate the balance with the AC adapter.

12. Specifications

12.1 Basic Specifications

Model	SJ- 220CE	SJ- 420CE	SJ- 620CE	SJ- 1200CE	SJ- 2200CE	SJ- 4200CE	SJ- 6200CE	SJ- 12KCE
Max [g]	220	420	620	1200	2200	4200	6200	12000
Min [g]	0.2	0.2	0.5	5	5	5	5	50
e [g]	0.01	0.01	0.1	0.1	0.1	0.1	1	1
d [g]	-	-	0.01	-	-	-	0.1	-
Max [ct]	1100	2100	3100	6000	11000	21000		
Min [ct]	2	2	5	50	50	50	Not ava	ailahla
e [ct]	0.1	0.1	1	1	1	1	Notav	aliable
d [ct]	-	-	0.1	-	-	-		
Measurable unit weight in counting mode [g]	0.01	0.01	0.01	0.1	0.1	0.1	0.1	1
Minimum weight in percentage mode [g]	1	1	1	10	10	10	10	100
Pan Size [mm]		φ140		170×140		180>	< 160	

12.2 Common Specifications

(1)	Weight measuring method	. Tuning fork vibration method
(2)	Tare subtraction range	. Total capacity
(3)	Liquid-crystal display (LCD)	. Seven segments (two segments in leading part), Maximum digits indication: seven digits, Segment height: 16.5 mm.
(4)	Calibration (span adjustment)	. Span adjustment with external weight (possible only when unsealed.)
(5)	Overload indication	. [o-Err] is displayed if weight capacity + 9 intervals are exceeded.
(6)	Compatible printer	. CSP-160
(7)	Operating temperature and humidity ranges .	. 10°C to 30°C, 80%rh or less
(8)	AC adapter	. Dedicated AC adapter: 230V AC / 9V - 12V DC
(9)	Lower limit of battery voltage	. 6V
(10)	Options	. RS232C output under weighing hook Relay contact output

12.3 Capacities and Minimum Indications for Different Indication Units

	SJ-	SJ-						
	220CE	420CE	620CE	1200CE	2200CE	4200CE	6200CE	12KCE
gram(g)	220	420	620	1200	2200	4200	6200	12000
gi alli (g)	0.01	0.01	0.01	0.1	0.1	0.1	0.1	0.1
carat(ct)	1100	2100	3100	6000	11000	21000	Not abailable	
carat(ct)	0.1	0.1	0.1	1	1	1	NOT ab	allable
011000(07)	7.7	14	21	42	77	140	210	420
ounce(oz)	0.001	0.001	0.001	0.01	0.01	0.01	0.01	0.01
pound(lb)	0.48	0.92	1.3	2.6	4.8	9.2	13	26
pourid(ib)	0.0001	0.0001	0.0001	0.001	0.001	0.001	0.001	0.001
trov 011000(07t)	7	13	19	38	70	130	190	380
troy ounce(ozt)	0.001	0.001	0.001	0.01	0.01	0.01	0.01	0.01
penny weight	140	270	390	770	1400	2700	3900	7700
(dwt)	0.01	0.01	0.01	0.1	0.1	0.1	0.1	0.1
tael(tl)	5.8	11	16	32	58	110	160	320
(Hong Kong)	0.001	0.001	0.001	0.01	0.01	0.01	0.01	0.01
tael(tl)	5.8	11	16	31	58	110	160	310
(Singapore,								
Malaysia)	0.001	0.001	0.001	0.01	0.01	0.01	0.01	0.01
tael(tl)	5.8	11	16	32	58	110	160	320
(Taiwan)	0.001	0.001	0.001	0.01	0.01	0.01	0.01	0.01
momme	58	110	160	320	580	1100	1600	3200
(mom)	0.01	0.01	0.01	0.1	0.1	0.1	0.1	0.1
tolo(to)	18	36	53	100	180	360	530	1000
tola(to)	0.001	0.001	0.001	0.01	0.01	0.01	0.01	0.01

The view of the table

Upper cell : Capacity
Lower cell : Readability

13. Conversion Table of Units

unit	gram	carat	ounce	pound	troy ounce	penny weight
1g	1	5	0.03527	0.00220	0.03215	0.64301
1ct	0.2	1	0.00705	0.00044	0.00643	0.12860
1oz	28.34952	141.74762	1	0.06250	0.91146	18.22917
1lb	453.59237	2267.96185	16	1	14.58333	291.66667
1ozt	31.10348	155.51738	1.09714	0.06857	1	20
1dwt	1.55517	7.77587	0.05486	0.00343	0.05	1
1tl (Hong Kong)	37.429	187.145	1.32027	0.08252	1.20337	24.06741
1tl (SGP,MYS)	37.79936	188.99682	1.33333	0.08333	1.21528	24.30556
1tl (Taiwan)	37.5	187.5	1.32277	0.08267	1.20565	24.11306
1mom	3.75	18.75	0.13228	0.00827	0.12057	2.41131
1to	11.66380	58.31902	0.41143	0.02571	0.37500	7.5

unit	tael (Hong Kong)	tael (Singapore, Malaysia)	tael (Taiwan)	momme	tola
1g	0.02672	0.02646	0.02667	0.26667	0.08574
1ct	0.00534	0.00529	0.00533	0.05333	0.01715
1oz	0.75742	0.75	0.75599	7.55987	2.43056
1lb	12.11874	12	12.09580	120.95797	38.88889
1ozt	0.83100	0.82286	0.82943	8.29426	2.66667
1dwt	0.04155	0.04114	0.04147	0.41471	0.13333
1tl (Hong Kong)	1	0.99020	0.99811	9.98107	3.20899
1tl (SGP,MYS)	1.00990	1	1.00798	10.07983	3.24074
1tl (Taiwan)	1.00190	0.99208	1	10	3.21507
1mom	0.10019	0.09921	0.1	1	0.32151
1to	0.31162	0.30857	0.31103	3.11035	1